Ship Name: CS CANDY Recognized Org: Llovd's Register

Ship Type: Bulk Carrier Recognized Security Organization (RSO): Flag: Bahamas

Recognized Org IMO Number: 9542544 **Class Related**

(RO) Related: Date of Action: 9/24/2024

Relevant Certificates: ISM - Safety Management Certificates Action Taken: Detention SOLAS Cargo Ship Safety Equipm

SOLAS Cargo Ship Safety Constru

Organization Related Lloyd's Register Port: Los Angeles, California

to Detention:

Ship Management: Owners, Operators, or Managers

Campbell Shipping Co Ltd

Candy Shipping Company Limited

Deficiencies: Code - Category Description

Unit: Sector Los Angeles-Long Beach

15109 - Maintenance of the ship and equipment

OBJECTIVE EVIDENCE DISCOVERED DURING AN EXPANDED ISM EXAM REVEALED THE FOLLOWING DEFICIENCY: THE VESSEL FAILED

TO FULLY IMPLEMENT THE REQUIREMENTS OF

THE ISM CODE THROUGH THEIR SMS PROCEDURES. THE VESSEL DID NOT TAKE APPOPRIATE ACTIONS ON IDENTIFIED NON-CONFORMITIES. THIS IS MADE EVIDENT BY **DEFICIENCIES 2-7. A SAFETY MANAGEMENT** AUDIT MUST BE CARRIED OUT BY THE

ADMINISTRATION / RO BEFORE THE SHIP MAY

BE RELEASED FROM DETENTION.

07126 - Oil accumulation in engine

room

MEANS SHALL BE PROVIDED TO CONTROL LEAKS OF FLAMMABLE LIQUIDS. PSCO OBSERVED EXCESSIVE FUEL OIL-SOAKED LAGGING AROUND TWO OF THE VESSEL'S GENERATORS AND MAIN DIESEL ENGINE.

07126 - Oil accumulation in engine

room

MEANS SHALL BE PROVIDED TO CONTROL LEAKS OF FLAMMABLE LIQUIDS, PSCO OBSERVED AN EXCESSIVE AMOUNT OF FUEL OIL ACCUMULATION ON TWO OF THE VESSEL'S

GENERATORS.

14119 - Oil and oily mixtures from

machinery spaces

AN EFFICIENT BILGE PUMPING SYSTEM SHALL BE PROVIDED, CAPABLE OF PUMPING FROM AND DRAINING ANY WATERTIGHT

COMPARTMENT. PSCO OBSERVED AN ACCUMULATION OF APPROXIMATELY SIX INCHES OF OILY WATER IN ENGINE ROOM BILGE WELLS, CAUSED BY AN APPROXIMATELY GALLON A MINUTE LEAK FROM NEARBY

BALLAST PUMP.

11105 - Rescue boat inventory

ALL LIFE-SAVING APPLIANCES AND ARRANGMENTS SHALL COMPLY WITH THE APPLICABLE REQUIREMENTS OF THE CODE. EXCEPT AS OTHERWISE STATED, THE NORMAL EQUIPMENT OF EVERY RESCUE BOAT SHALL CONSIST OF A SEARCHLIGHT. PSCO OBSERVED THAT THE ELECTRICAL PANEL FOR THE RESCUE BOAT WAS IMPROPERLY MOUNTED/SECURED CAUSING THE SEARCHLIGHT, COMPASS LIGHT, AND RECEPTACLE FOR THE PORTABLE LIGHT TO NOT OPERATE AS DESIGNED